

Work Order ID: 141705

RUSH ASAP

Work Order ID 141705

Tuesday, February 09, 2016 11:25:02 AM

141705

U/R

OK d 16/2/16 Page 1

Item ID: D119-646-041

Accept

N900040100

Setup Start

NS1

Revision ID: URF15-560

Item Name: Replacement Skidtube with Wearpads, Fits LH or RH

Stop

NS2

Start Date: 2/9/2016 Start Qty: 1.00

1

Cust Item ID:

Required Date: 2/22/2016 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan: MLS

Date: FEB 09 2016

Tooling:

Date:

Run Start

NR1

QC:

Date:

SPC (Y/N):

Date:

Stop

NR2

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
Draw Nbr	Revision Nbr								
D3887-041	D								
IIN-D119-646	C								

100

0.00

100

DC

Memo

0.00

Doc.Control -USB or Paperwork

Photocopy bluefile & type labels per PPP D119-646-041

CHG003

N/A MS

FEB 29 2016

110

0.00

110

Skidtubes

Memo

0.00

Skidtubes

1- inspect Mat'L D2500-1-190 for damage

2-Cut tube to length as per dwg D3887 (154.8")

3- Ensure squareness of ends and scribe batch#

16-2-10

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed ~~RAI~~

Date: 16/06/07

Work Order update only ☐

Work Order: 141705	DISPOSITION Rework ☒ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS			
Part No. D117646-041		Skid-tube ☒	Cross tube ☐	Water Jet ☐	Engineering ☒
NCR No. 16-5811		Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐
		Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐
		Large Fab ☐	Composite ☐	Supplier ☐	

Date: 16/2/16	Step #: 130	QTY Effective: 10	MRB (QSI042) Approval DAS 12 9-89 16/2/16
---------------	-------------	-------------------	--

Description Work Order Deviation	Disposition	
Modify web prior to insertion for compatibility with DSI 5734	Drill / ovalize web per attached figure.	Completed By 16-2-16
	Dwg to be update	Lead hand / Supervisor Approval Verification PD 16-02-16
		QC / QA Coordinator Approval PD 16-02-16

Root Cause Environment ☐ No Re-verification ☐ Design ☒ Operator ☐ Doc/Data ☐ Offset/Setup ☐ Equip/Tooling ☐ Supplier ☐ Handling/Pre ☐ Training ☐ Material ☐ Use for Testing ☐ Internal Transport ☐ Poor Information ☐ Tribal Knowledge ☐ Rushing ☐ LOA ☐ Product Improvement ☐ Substation ☐ Process Improvement ☐ Past Expiry Date ☐ Manufacturing Process ☐ Misidentified ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Temperature/Cure ☐ Power Loss/Surge ☐ Positioned Wrong ☐ Bending ☐ Set-up ☐ Folio/Program ☐ Outside Dimensions ☐ Centre Not Concentric ☐ BOM/Route ☐ Grain ☐ Over/Under tolerance ☐ Cracks ☐ Broken/Damage/Defect ☐ Weld ☐ Part Incorrect ☐ Crimp/Kink/Ripple/Wave ☐ Inspection Incomplete/Unqualified ☐ Wrong Stock Pulled ☐ Part Lost/Missing ☐ Cuffs ☐ Contamination ☐ Out of Sequence ☐ Part Moved ☐ Crushing ☐ Countersink ☐ Off-set ☐ Drawing ☒ Heat Treat ☐ Cut Too Short ☐ Misabeled ☐ Finish ☐ Wave/Twist in Tube ☐ Instructions Incomplete/Unclear ☐ Fit/Function ☐ Misread ☐ Marks/Chatter ☐ Drill Holes ☐ Misaligned/off center ☐ Turning Sequence ☐			
OTHER: _____					

H:/FORMS/Quality Assurance\approved QA/NCRWO Rev I

H:/FORMS/Quality Assurance\approved QA/NCRWO Rev I

Work Order ID 141705***141705***

Page 4

Tuesday, February 09, 2016 11:25:02 AM

Item ID: D119-646-041

Accept

N900040100Setup Start ***NS1***

Revision ID: URF15-560

Item Name: Replacement Skidtube with Wearpads, Fits LH or RH

Stop ***NS2***Start Date: 2/9/2016 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 2/22/2016 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

135

QC5- Inspect part completeness to step on W/O

0.00

135

QC

Memo

0.00

Quality Control

**DA8
18
9-89**1 0 16-02-17

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval	
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								

Work Order ID 141705***141705***

Page 5

Tuesday, February 09, 2016 11:25:02 AM

Item ID: D119-646-041 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: URF15-560 Stop ***NS2***
Item Name: Replacement Skidtube with Wearpads, Fits LH or RH
Start Date: 2/9/2016 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 2/22/2016 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

140

140

Skidtubes

Skidtubes

Memo

0.00

1- Bend FWD end of tube using bender 1 and FOLIO 31 bend prog.
D3887.***Must use bending aid DT9544, ensure proper positioning***

2- Cut FWD end of tube as per dwg D3887.***Verify measurement***

3- Buff out marks left from bending

4- Drill FWD cap holes using DT8215. Open FWD & AFT cap holes to 0.208"

5- Open FWD saddle holes to finished size as per dwg D3887

6- Drill FWD x-bolt spacer holes using DT9816 and open to finished
size.(verify measurement)

7- Drill Tow ring hole, using DT10047 locate from FWD saddle hole.(verify
measurement). Open to finished size.

8- Drill 1.87" and 3.74 holes using DT10045 A&B locate from FWD saddle
hole.(verify measurement) as per dwg.

9- C'sink FWD cap hole as per detail "C"

10- Drill holes for wearpads using DT8931, open to 0.297".

11- Countersink crossbolt spacer holes, and prepare tube for welding, deburr.

12- Deburr and blow out chips from inside of tube.

ftr

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval 		
Description Work Order Deviation				Disposition					
							Completed By		
							Lead hand / Supervisor Approval Verification		
							QC / QA Coordinator Approval		
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐							
☐ OTHER : _____									

Work Order ID 141705

Tuesday, February 09, 2016 11:25:02 AM

141705

Page 6

Item ID: D119-646-041 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: URF15-560 Stop ***NS2***
Item Name: Replacement Skidtube with Wearpads, Fits LH or RH
Start Date: 2/9/2016 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 2/22/2016 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

150

QC5- Inspect part completeness to step on W/O

0.00

150

QC

Memo

0.00

Quality Control

DAS
18
9-891 6 16-02-18

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : ☐					

Work Order ID 141705***141705***

Page 7

Tuesday, February 09, 2016 11:25:02 AM

Item ID: D119-646-041 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: URF15-560 Stop ***NS2***
Item Name: Replacement Skidtube with Wearpads, Fits LH or RH
Start Date: 2/9/2016 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 2/22/2016 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

160

0.00

160

Skidtubes

Skidtubes

Memo

0.00

NOTE: TACK IN 2 MOST FWD X-BOLT SPACERS AND TEST FIT FWD
GROUND HANDLING FIXTURE, IF FIXTURE FITS WELL THEN
PROCEED. FIXTURE DT10091.

1-Insert crossbolt spacers. Weld as per QSI 004 and Dwg D3887. Remember to
back drill each hole before welding the other side. Use aluminum rod
A/RAluminum Rod *M133816*

2-Grind cross bolt welds flush as per Dwg D3887. Ensure no pin hole.

3-Counterbore 5/16" x 0.750" deep as per Dwg D3887.

4- Deburr & Scribe batch # on Aft end of tube.

170

QC5- Inspect part completeness to step on W/O

0.00

170

QC

Quality Control

Memo

0.00

TEST FIT USING FIXTURE DT10091.

DAS
9
9-89

BE 16-02-18
DA 16-2-18
① 16-02-19

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition			
				Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER : ☐					

Work Order ID 141705

Tuesday, February 09, 2016 11:25:02 AM

141705

Page 8

Item ID: D119-646-041 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: URF15-560 Stop ***NS2***
Item Name: Replacement Skidtube with Wearpads, Fits LH or RH
Start Date: 2/9/2016 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 2/22/2016 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

180	QC10- Inspect visual per QSI004- ground welds	0.00							DAS
180									9
QC	Memo	0.00							9-89
Quality Control									

190	Pressure Wash per QSI005 4.3	0.00							
190									
HandFinish	Memo	0.00							
Hand Finishing	Re-alodine tube as per QSI 005 section 4.1.2.1 do not acid etch.								

200	White Gloss(Ref:4.3.5.1) per QSI005 4.3-Alum	0.00							
200									
Powdercoat	Memo	0.00							
Powder Coating	START TIME: 11:30								
	OVEN TEMPERATURE: 325								
	FINISH TIME: 12:00								

★
SEE
Attached

1 16-02-22 233

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER : ☐					

Tuesday, February 09, 2016 11:25:02 AM

Page 9

Accept

Setup Start *NS1*

Stop *NS2*

Start Date: 2/9/2016 **Start Qty:** 1.00 ***1***

Cust Item ID:

Required Date: 2/22/2016 **Req'd Qty:** 1.00 ***1***

Customer:

Reference:

Approvals: **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____

Run Start *NR1*

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Operation Description

Set Up/ Run Hours

Tool ID**Tool #**

Plan Code

**Accept
Qty**

Reject
QtyReject
Number

**Insp.
Stamp**

210

QC3- Inspect Part Finish

0.00

210

QC

Memo

0.00

Quality Control

220

0.00

220

HandFinish

Memo

0.00

Hand Finishing

1-Install inserts as per Dwg D3887.

230

QC5- Inspect part completeness to step on W/O

0.00

230

QC

Memo

0.00

Quality Control

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐																																																											
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval																																																							
Description Work Order Deviation				Disposition				Completed By																																																							
								Lead hand / Supervisor Approval Verification																																																							
								QC / QA Coordinator Approval																																																							
Root Cause		FAULT CATEGORY																																																													
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐	Past Expiry Date ☐	Manufacturing Process ☐	OTHER : ☐	
Misidentified ☐	Past Due ☐																																																														

Work Order ID 141705

Tuesday, February 09, 2016 11:25:02 AM

141705

Page 10

Item ID: D119-646-041 Accept ***N900040100*** Setup Start ***NS1***
 Revision ID: URF15-560 Stop ***NS2***
 Item Name: Replacement Skidtube with Wearpads, Fits LH or RH
 Start Date: 2/9/2016 Start Qty: 1.00 ***1*** Cust Item ID:
 Required Date: 2/22/2016 Req'd Qty: 1.00 ***1*** Customer:
 Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
 QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
240		0.00							
240									
HandFinish		0.00							
Hand Finishing	★ SEE Attached Memo 1-Install wearpads, gaskets as per Dwg D3887. Put sikaflex in insert before installing bolts and washers A/R Sikaflex-240/-291 <u>M1133862</u> Sikaflex expire date: <u>16112</u> 2-assemble o'ring to plug as per dwg D3492 and apply o'ring lube A/R 55-o'ring lube batch: <u>M133145</u> RTU 598 M133136 16105 3 -Inspect for foreign objects as per QSI 024 4 -Install Aft Cap and seal with Sikaflex. Clean excess adhesive. A/R Sikaflex-240/-291 <u>M1133862</u> Sikaflex expire date: <u>16112</u>								
245	QC5- Inspect part completeness to step on W/O	0.00							
245									
QC		0.00							
Quality Control	Memo								

DAS
38
9-89

FEB 23 2016

DAS
38
9-89

FEB 23 2016

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐						OTHER : ☐	

Work Order ID 141705***141705***

Page 11

Tuesday, February 09, 2016 11:25:02 AM

Item ID: D119-646-041 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: URF15-560 Stop ***NS2***
Item Name: Replacement Skidtube with Wearpads, Fits LH or RH
Start Date: 2/9/2016 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 2/22/2016 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
250 *250* HandFinish Hand Finishing	Wing Walk as per dwg QSI005 4.4 Batch <u>139170</u> Memo	0.00 0.00				<u>1x</u>	<u>f</u>	<u>16/02/27</u>	
251 *251* QC Quality Control	QC3- Inspect Part Finish Memo	0.00 0.00				<u>1</u>			DAS 38 9-89 FEB 23 2016
260 *260* Packaging Packaging	Identify as per dwg & Stock Location <u>4/0</u> Memo <u>141587</u>	0.00 0.00				<u>1x</u>		<u>16/02/27</u>	DAS 36 9-89

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval 	
Description Work Order Deviation				Disposition					
								Completed By	
								Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval					

Root Cause				FAULT CATEGORY							
Environment	☐	No Re-verification	☐	Pressure/Forced	☐	Temperature/Cure	☐	Power Loss/Surge	☐	Positioned Wrong	☐
Design	☐	Operator	☐	Bending	☐	Set-up	☐	Folio/Program	☐	Outside Dimensions	☐
Doc/Data	☐	Offset/Setup	☐	Centre Not Concentric	☐	BOM/Route	☐	Grain	☐	Over/Under tolerance	☐
Equip/Tooling	☐	Supplier	☐	Cracks	☐	Broken/Damage/Defect	☐	Weld	☐	Part Incorrect	☐
Handling/Pre	☐	Training	☐	Crimp/Kink/Ripple/Wave	☐	Inspection Incomplete/Unqualified	☐	Wrong Stock Pulled	☐	Part Lost/Missing	☐
Material	☐	Use for Testing	☐	Cuffs	☐	Contamination	☐	Out of Sequence	☐	Part Moved	☐
Internal Transport	☐	Poor Information	☐	Crushing	☐	Countersink	☐	Off-set	☐	Drawing	☐
Tribal Knowledge	☐	Rushing	☐	Heat Treat	☐	Cut Too Short	☐	Mislabeled	☐	Finish	☐
LOA	☐	Product Improvement	☐	Wave/Twist in Tube	☐	Instructions Incomplete/Unclear	☐	Fit/Function	☐	Misread	☐
Substation	☐	Process Improvement	☐	Marks/Chatter	☐	Drill Holes	☐	Misaligned/off center	☐	Turning Sequence	☐
Past Expiry Date	☐	Manufacturing Process	☐	OTHER : _____							
Misidentified	☐	Past Due	☐								

Work Order ID 141705***141705***

Page 12

Tuesday, February 09, 2016 11:25:02 AM

Item ID: D119-646-041 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: URF15-560 Stop ***NS2***
Item Name: Replacement Skidtube with Wearpads, Fits LH or RH
Start Date: 2/9/2016 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 2/22/2016 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
270	QC21- Final Inspection - Work Order Release	0.00							
270									
QC	Memo	0.00							
Quality Control									

MCS FEB 29 2016

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval	
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								

Picklist Print

Page 1

Tuesday, February 09, 2016 11:25:06 AM

Work Order ID: 141705

141705

Parent Item: D119-646-041

D119-646-041

Parent Item Name: Replacement Skidtube with Wearpads, Fits LH or RH

Start Date: 2/9/2016

Required Date: 2/22/2016

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP RevA: New issue DD verified by:EC IPP rev B
10.02.22 per PAR 09-043 EC verified by:DD IPP REVC 12.11.05
(DEOD3887-B-1)(ecn 12-675) DD verf:JLM IPP REV:D 13.03.20 per
chg003 ECN13-534 DD verf:JLM

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
---------------------------------	------------------------	---------------	-------------	---------------------	------------------	-----------------	--------------------	----------------	-------------	--------------	---------------	----------------	--------

D2500-1-190

Manufactured No

110

Each

22.0000

1

1

D2500-1-190

Ext'n -I' Beam Tube 4"

**

16-2-11

Location

Loc Qty

Loc Code

HALL

22

134259

22

D2579

Manufactured No

140

Each

21.0000

2

2

D2579

Crossbolt Spacer

**

BE16-02-18

Location

Loc Qty

Loc Code

LG001

21

123997

21

D2855-3

Manufactured No

240

Each

53.0000

2

2

D2855-3

Cap

**

all 16/02/2016

Location

Loc Qty

Loc Code

FP001

53

135830

3

137525

50

B1351121

x2

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval	
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐							
		OTHER : ☐							

Picklist Print

Tuesday, February 09, 2016 11:25:06 AM

Work Order ID: 141705

141705

Parent Item: D119-646-041

D119-646-041

Parent Item Name: Replacement Skidtube with Wearpads, Fits LH or RH

Start Date: 2/9/2016

Required Date: 2/22/2016

Start Qty: 1.00

Required Qty: 1.00

NAS1611-005

Purchased No

240

Each

439.0000

16

16

NAS1611-005

O-RING

**

ll 16/02/22

Location

Loc Qty

Loc Code

FP001

439

m129198

11

m133498

428

D3492-5

Manufactured No

240

Each

51.0000

16

16

D3492-5

Plug

**

ll 16/02/22

Location

Loc Qty

Loc Code

FP001

51

133396

8

136396

6

138198

2

138880

35

D3672-1

Manufactured No

240

Each

686.0000

2

2

D3672-1

Washer, Phenolic

**

ll 16/02/22

Location

Loc Qty

Loc Code

FG

10

85222

10

ST049

176

112218

72

127322

104

ST051A

500

134785

500

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐							
		OTHER : ☐							

Picklist Print

Tuesday, February 09, 2016 11:25:06 AM

Page 3

Work Order ID: 141705

141705

Parent Item: D119-646-041

D119-646-041

Parent Item Name: Replacement Skidtube with Wearpads, Fits LH or RH

Start Date: 2/9/2016

Required Date: 2/22/2016

Start Qty: 1.00

Required Qty: 1.00

D3681-1 Manufactured No

160 Each 73.0000 8 8

D3681-1

Spacer

**

BK16-0218

Location

Loc Qty

Loc Code

LG001

73

138818

32

139031

32

139615

9

4

4

D3847-1 Manufactured No

240 Each 15.0000 5 5

D3847-1

Wearpad

**

11 16/02/22

Location

Loc Qty

Loc Code

FP001

15

135979

5

138338

10

XS

D3847-11 Manufactured No

240 Each 6.0000 1 1

D3847-11

Wearpad

**

B141896 (1x) 11 16/02/23

Location

Loc Qty

Loc Code

FP001

6

137781

4

138418

2

D3885-1 Manufactured No

140 Each 18.0000 1 1

D3885-1

Standard Web

**

16-2-16

Location

Loc Qty

Loc Code

LG002

18

136841

8

136925

10

1

Tuesday, February 09, 2016 11:25:06 AM

Shop Packet Print

Page 3

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation			Disposition		
			Completed By		
			Lead hand / Supervisor Approval Verification		
			QC / QA Coordinator Approval		
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : ☐					

Picklist Print

Tuesday, February 09, 2016 11:25:06 AM

Page 4

Work Order ID: 141705

141705

Parent Item: D119-646-041

D119-646-041

Parent Item Name: Replacement Skidtube with Wearpads, Fits LH or RH

Start Date: 2/9/2016

Required Date: 2/22/2016

Start Qty: 1.00

Required Qty: 1.00

D3903-1 Manufactured No

160 Each 117.0000 12 12

D3903-1

Spacer

**

BL16-02-18

Location

Loc Qty

Loc Code

LG001

117

140943

117

12

ALS4-1032-130 AE4LS4-1032-130 Purchased No

220 Each 1,631.000 30 30

ALS4-1032-130

Rivnut

**

all 16/02/22

Location

Loc Qty

Loc Code

FP001

1631

M133077

1631

X30

AN3C5A Purchased No

240 Each 775.0000 32 32

AN3C5A

Bolt

**

all 16/02/22

Location

Loc Qty

Loc Code

FG

5

122800

5

FP001

70

M133234

54

M133769

16

X12

OVER002

600

X20

M133686

600

ST338a

100

M125388

35

m127290

3

M131803

42

M132640

20

Tuesday, February 09, 2016 11:25:06 AM

Shop Packet Print

Page 4

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								

Picklist Print

Tuesday, February 09, 2016 11:25:07 AM

Work Order ID: 141705

141705

Parent Item: D119-646-041

D119-646-041

Parent Item Name: Replacement Skidtube with Wearpads, Fits LH or RH

Start Date: 2/9/2016

Required Date: 2/22/2016

Start Qty: 1.00

Required Qty: 1.00

NAS1149C0332R

Purchased

No

Each

5,387.000

32

NAS1149C0332R

WASHER

lll 16/02/22

Location

Loc Qty

Loc Code

FP001

2592

m132262

4

m132930

1004

m134073

1584

x32

GA

76

m133284

76

ST266

2719

m133284

719

m134063

2000

MS24694-C52

Purchased

No

Each

121.0000

2

MS24694-C52

SCREW

lll 16/02/22

Location

Loc Qty

Loc Code

FP001

115

m127059

17

m133855

98

x2

ST287

6

124308

6

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval	
Description Work Order Deviation				Disposition					
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐							
OTHER : ☐									

8 7 6 5 4 3 2 1

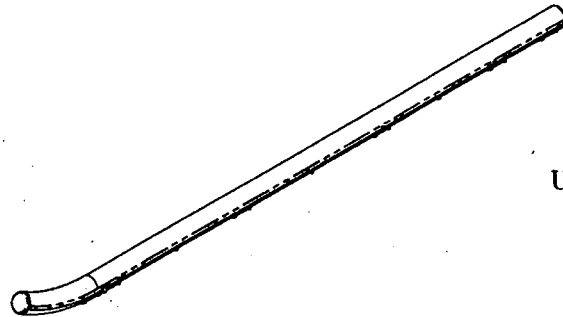

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 141705 MJS
16-02-09

D3887-041 STANDARD SKIDTUBE ASSY WITH WEARPAD (SHOWN)
D3887-043 STANDARD SKIDTUBE ASSY WITH WEAPLATE (SIMILAR)
D3887-045 STANDARD SKIDTUBE ASSY WITH TRAINING WEARPLATE (SIMILAR)

ITEM	QTY -041	QTY -043	QTY -045	P/N	DESCRIPTION
1	X			D3887-041	STD SKIDTUBE ASSY WITH WEARPAD
2		X		D3887-043	STD SKIDTUBE ASSY WITH WEARPLATE
3			X	D3887-045	STD SKIDTUBE ASSY WITH TRAINING WEARPLATE
10	2	2	2	D2578	CROSS BOLT SPACER
11	2	2	2	D2855-3	CAP
12	16	16		D3492-045	PLUG ASSY
13	2	2	2	D3672-1	PHENOLIC WASHER
14	8	8	8	D3681-1	SPACER
17	5	5		D3847-1	WEARPAD
18	1	1		D3847-11	AFT WEARPAD
19		1		D3847-043	FWD WEARPLATE ASSY
20		1		D3847-045	CENTER WEARPLATE ASSY
21		1		D3847-047	AFT WEARPLATE ASSY
22			1	D3849-041	FWD TRAINING WEARPLATE ASSY
23			1	D3849-043	AFT WEARPLATE ASSY
24	1	1	1	D3885-1	STANDARD WEB
25	1	1		D3887-11	STANDARD SKIDTUBE
26			1	D3887-13	STANDARD SKIDTUBE
27	12	12	12	D3903-1	SPACER
28			16	D3904-1	WASHER
41	30	30		ALS4-1032-130	INSERT
42	32	32	2	AN3C5A	BOLT
43			8	AN3C46A	BOLT
44	32	32		NAS1149C0332R	WASHER (OR AN960C10L)
45			8	MS21043-3	NUT
46	2	2	2	MS24694-C52	SCREW

RELEASED

UNDER REVIEW

15.04.30 URF15-560 AP

2014 NOV 24
ECN 14-688

NOTES:

- 1) MATERIAL: N/A
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1 PRIOR TO INSERTING D3885-1 WEB
POWDER COAT "WHITE" (4.3.5.1) PER DART QSI 005 4.3
BLACK ANTI-SKID PAINT AS INDICATED TO 0.5 ABOVE LOCATION RIDGE PER DART QSI 005 4.4
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX
- 6) IDENTIFICATION: NONE
- 7) WEIGHT: D3887-041 = 32.0 lbs
D3887-043 = 37.0 lbs
D3887-045 = 38.1 lbs
- 8) WELD PER DART QSI 004
- 9) DAMAGE TOLERANCE ON FWD BEND:
THERE SHOULD BE NO VISIBLE WRINKLES IN THE BEND FROM THE GROUND TO A HEIGHT OF 8.5 INCHES ABOVE THE GROUND. IT IS ACCEPTABLE TO POLISH OUT GOUGES UP 0.020" DEEP IN THE BENT PORTION OF THE TUBE. A MAXIMUM REDUCTION IN DIAMETER OF 0.150" IS ACCEPTABLE IN THE BENT PORTION OF THE TUBE.
- 10) INSERT D3885-1 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH SIKAFLEX-2411-291 ADHESIVE PER DART QSI 015 BEFORE BENDING. ENSURE HOLES LINE-UP
- 11) INSERT D3492-045 PLUG ASSY INTO Ø0.187 HOLES (BOTH SIDES OF TUBE)
- 12) USE DART DRILL TEMPLATE DT8931 TO LOCATE AND DRILL Ø0.297 HOLES FOR WEARPLATE INSERTS. INSTALL AELS-1032-130 INTO D3887-11 ONLY. INSTALL AN3C5A BOLTS AND NAS1149C0332R WASHERS WITH SIKAFLEX-2411-291.

D	REVISED BEND TOLERANCES FOR MANUFACTURABILITY, 135.07 WAS 134.04 (ZN D5-8), ADD 5.07 (ZN C2-3), ADD 116.8 (ZN D5-8), DELETE GASKETS (BOM, SH 2)	DB	13.09.20
C	(SHT1, P/L ZN C2-2, C3-2, C4-2) ITEM 13, QTY 2 WAS 4, ITEM 42, QTY 32 WAS 34, ITEM 44, QTY 30 WAS 32, ADD ITEM 46, MS24694-C52 WAS AN3C5A, 2 PLCS (ZN C1-5, C1-6, B4-7) Ø0.201 CSK Ø0.385 X 100 WAS Ø0.214 THRU, ADD DETAIL F (ZN C6-5, C8-4, B5-7), ADD ITEM 10, D2578 CROSS BOLT SPACER (ZN D4-1, A6-7)	DB	13.02.19
B	ALS4-1032-130 WAS AELS-1032-130 (ZN C4-1, C5-7, C3-7); ADD DT8931 (ZN A8-1); ADD 134.04 (ZN C4-8); D2855-3 WAS D2578 (ZN D4-1, C2-2, C2-3, C2-3, C7-4, C2-4); AN3C5A WAS AN3C4A (ZN C6-2, C2-2, C6-3, C2-3, C8-4, C2-4); Ø0.313 WAS Ø0.328 (ZN C4-5, C4-5, C2-7 & B3-7) REVISED NOTE N (ZN B3-7)	RF	09.06.30
A	NEW ISSUE	RF	09.03.30
REV.	DESCRIPTION	BY	DATE
DESIGN	RF		
DRAWN	DB		
CHECKED			
MFG. APPR.			
APPROVED			
DE APPR.			
DATE	13.09.20		
DART AEROSPACE USA, INC.			
KENT, WA			
DRAWING NO. D3887			
REV. D			
SHEET 1 OF 8			
TITLE A119 STD SKIDTUBE ASSY			
SCALE NTS			
COPYRIGHT © 2009 BY DART AEROSPACE USA, INC.			
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.			

AN3C5A BOLT
D3872-1 PHENOLIC WASHER
NAS1149C0332R WASHER
(1 PER SIDE)

SEAL WITH
SIKAFLEX-241/291

D2855-3 CAP

D3847-11
WEARPAD

BLACK ANTI-SKID TO 0.5
ABOVE LOCATION RIDGE
TYP

11
Ø0.187
8 PL PER SIDE
REF

AN3C5A BOLT
NAS1149C0332R WASHER
24 PL

PLUG UNUSED INSERTS WITH
AN3C5A BOLT
NAS1149C0332R WASHER
8 PL

D3847-1
WEARPAD
5 PL

D2855-3 CAP

SEAL WITH
SIKAFLEX-241/291

MS24694-C52 SCREW
(1 PER SIDE)

D3887-041 STANDARD SKIDTUBE ASSY WITH WEARPAD
(MAKE FROM D3887-11)

UNDER REVIEW

15.04.30 URF15-560 AP

RELEASED

2014 NOV 24 *q*

DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	DB	KENT, WA	
CHECKED		DRAWING NO.	REV. D
MFG. APPR.		D3887	SHEET 2 OF 8
APPROVED		TITLE	SCALE
DE APPR.		A119 STD SKIDTUBE ASSY	NTS
DATE	13.09.20	COPYRIGHT © 2008 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

AN3C5A BOLT
D3872-1 PHENOLIC WASHER
NAS1149C0332R WASHER
(1 PER SIDE)

SEAL WITH
SIKAFLEX-241/291

D2855-3 CAP

D3847-11
WEARPAD

D3847-047
AFT WEARPLATE ASSY

AN3C5A BOLT
NAS1149C0332R WASHER
30 PL

BLACK ANTI-SKID TO 0.5
ABOVE LOCATION RIDGE
TYP

11
Ø0.187
8 PL PER SIDE
REF

D3847-045
CENTER WEARPLATE ASSY

D3847-043
FWD WEARPLATE ASSY

D3847-1
WEARPAD
5 PL

D2855-3 CAP

SEAL WITH
SIKAFLEX-241/291

MS24684-C52 SCREW
(1 PER SIDE)

D3887-043 STANDARD SKIDTUBE ASSY WITH WEARPLATE
(MAKE FROM D3887-11)

UNDER REVIEW

15.04.30 URF15-560 AP

RELEASED

2014 NOV 24 *q*

DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	DB	KENT, WA	
CHECKED		DRAWING NO.	REV. D
MFG. APPR.		D3887	SHEET 3 OF 8
APPROVED		TITLE	SCALE
DE APPR.		A119 STD SKIDTUBE ASSY	NTS
DATE	13.09.20	COPYRIGHT © 2009 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS UNDERSTANDING THAT IT IS NOT TO BE REPRODUCED OR TRANSMITTED IN ANY FORM OR BY ANY MEANS, ELECTRONIC OR MECHANICAL, WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

AN3C5A BOLT
D3872-1 PHENOLIC WASHER
NAS1148C0332R WASHER
(1 PER SIDE)

SEAL WITH
SIKAFLEX-241/281

D2855-3 CAP

AN3C46A BOLT
D3904-1 WASHER, 2 PL
MS21043-3 NUT
8 PL

D3849-043
AFT TRAINING WEARPLATE ASSY

BLACK ANTI-SKID TO 0.5
ABOVE LOCATION RIDGE
TYP

2.00 DISTANCE TO D3885-1 WEB

1.5 1.5 1.5 1.5

1.5 D2855-3 CAP

SEAL WITH
SIKAFLEX-241/281

MS24684-C52 SCREW
(1 PER SIDE)

D3849-041
FWD TRAINING WEARPLATE ASSY

D3887-045 STANDARD SKIDTUBE ASSY WITH TRAINING WEARPLATE
(MAKE FROM D3387-13)


UNDER REVIEW

15.04.30 URF15-560 AP

RELEASED

2014 NOV 24 *ap*

DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	DB	KENT, WA	
CHECKED	<i>[Signature]</i>	DRAWING NO.	REV. D
MFG. APPR.	<i>[Signature]</i>	D3887	SHEET 4 OF 8
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	A119 STD SKIDTUBE ASSY	NTS
DATE	13.09.20	COPYRIGHT © 2009 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSES OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

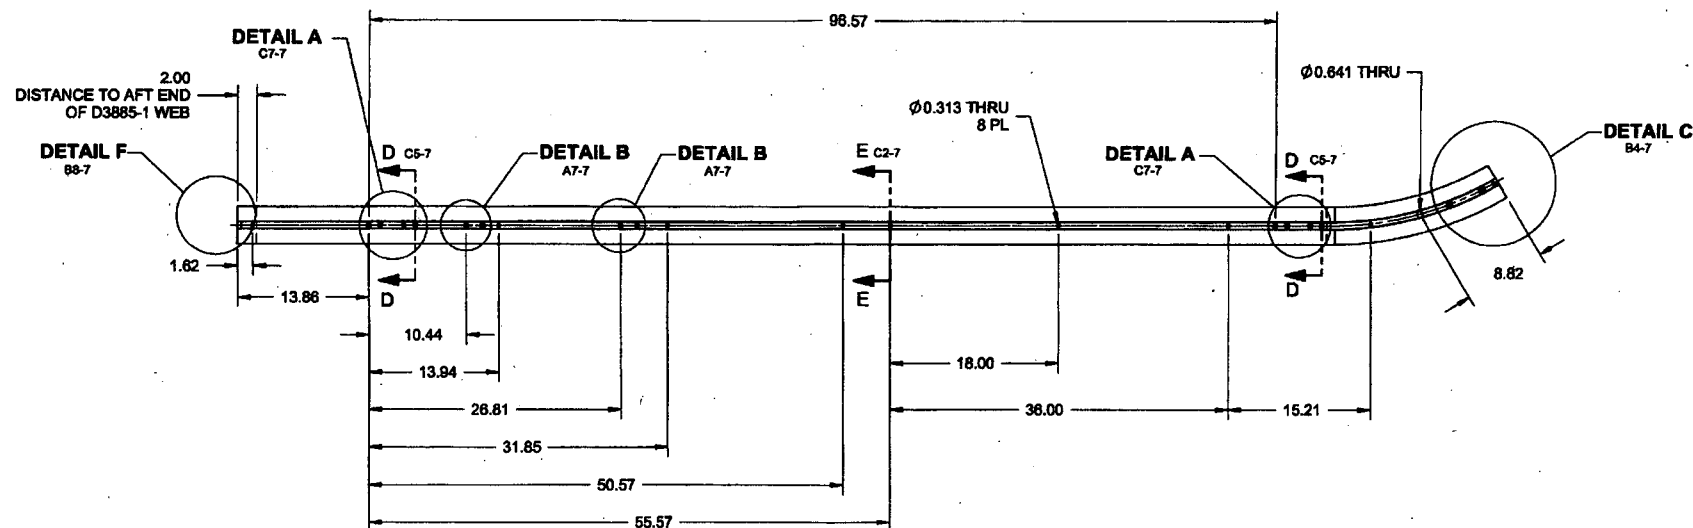

D3887-13 DRILLING DETAIL
(MAKE FROM D3887-1)


UNDER REVIEW

15.04.30 URF15-560 AP


RELEASED

2014 NOV 24 *up*


DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	DB	KENT, WA	
CHECKED	<i>[Signature]</i>	DRAWING NO.	REV. D
MFG. APPR.	<i>[Signature]</i>	D3887	SHEET 6 OF 8
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	A119 STD SKIDTUBE ASSY	NTS
DATE	13.09.20	COPYRIGHT © 2009 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY FORM OR BY ANY MEANS WITHOUT THE WRITTEN PERMISSION OF DART AEROSPACE USA, INC.	

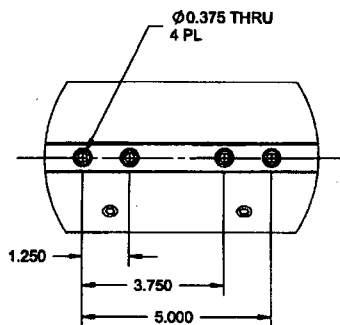


DETAIL A
SCALE 4X
D7-5
C3-5
D7-6
C3-6

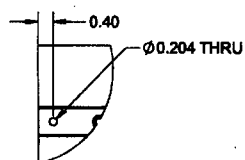


DETAIL F
SCALE 4X
C8-5
C8-6

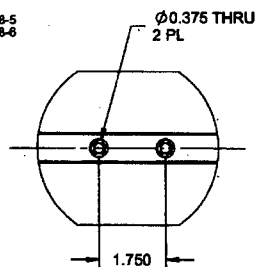


DETAIL B
SCALE 4X
C8-5
C5-5
C8-6
C5-6

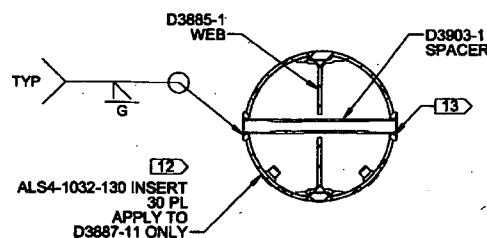

SECTION D-D
SCALE 4X
(FOR 12 X $\phi 0.375$ HOLES
PER SKIDTUBE)
C7-5
C3-5
C7-6
C2-6

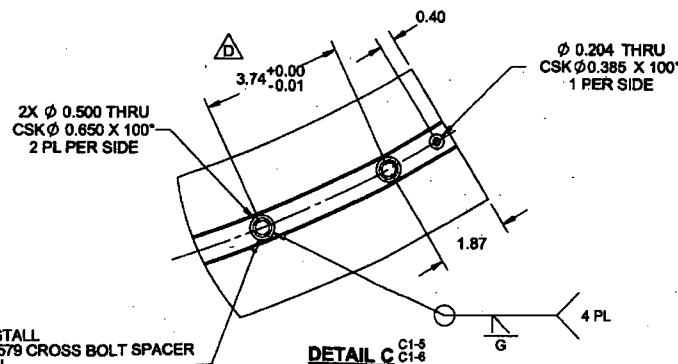

DETAIL C
TYPICAL
SCALE 4X
C1-5
C1-6

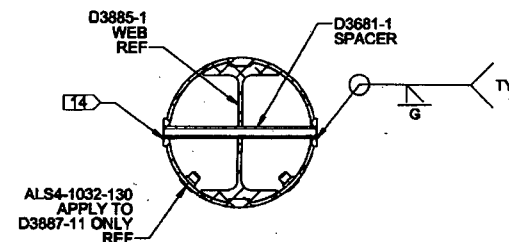

SECTION E-E
SCALE 4X
(FOR 8 X $\phi 0.313$ HOLES
PER SKIDTUBE)
C4-5
C4-6

NOTES:
13) AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR $\phi 0.375$ HOLES ONLY:
i) CHAMFER HOLES $\phi 0.475$ X 45"
ii) INSERT D3903-1 SPACER
iii) WELD INTO PLACE AND GRIND FLUSH
iv) CBORE TO 0.313 X 0.75 DEEP
v) DEBURR HOLES

14) AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR $\phi 0.313$ HOLES ONLY:
vi) CHAMFER HOLES $\phi 0.354$ X 45" OR 0.050 DEEP X 45" (BOTH SIDES)
vii) INSERT D3681-1 SPACER
viii) WELD INTO PLACE AND GRIND FLUSH
ix) DEBURR HOLES


UNDER REVIEW

15.04.30 URF15-560 AP

RELEASED

2014 NOV 24 q

DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	DB	KENT, WA	
CHECKED	DB	DRAWING NO.	REV. D
MFG. APPR.	DB	D3887	SHEET 7 OF 8
APPROVED	DB	TITLE	SCALE
DE APPR.	DB	A119 STD SKIDTUBE ASSY	NTS
DATE	13.09.20	COPYRIGHT © 2009 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY MANNER WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

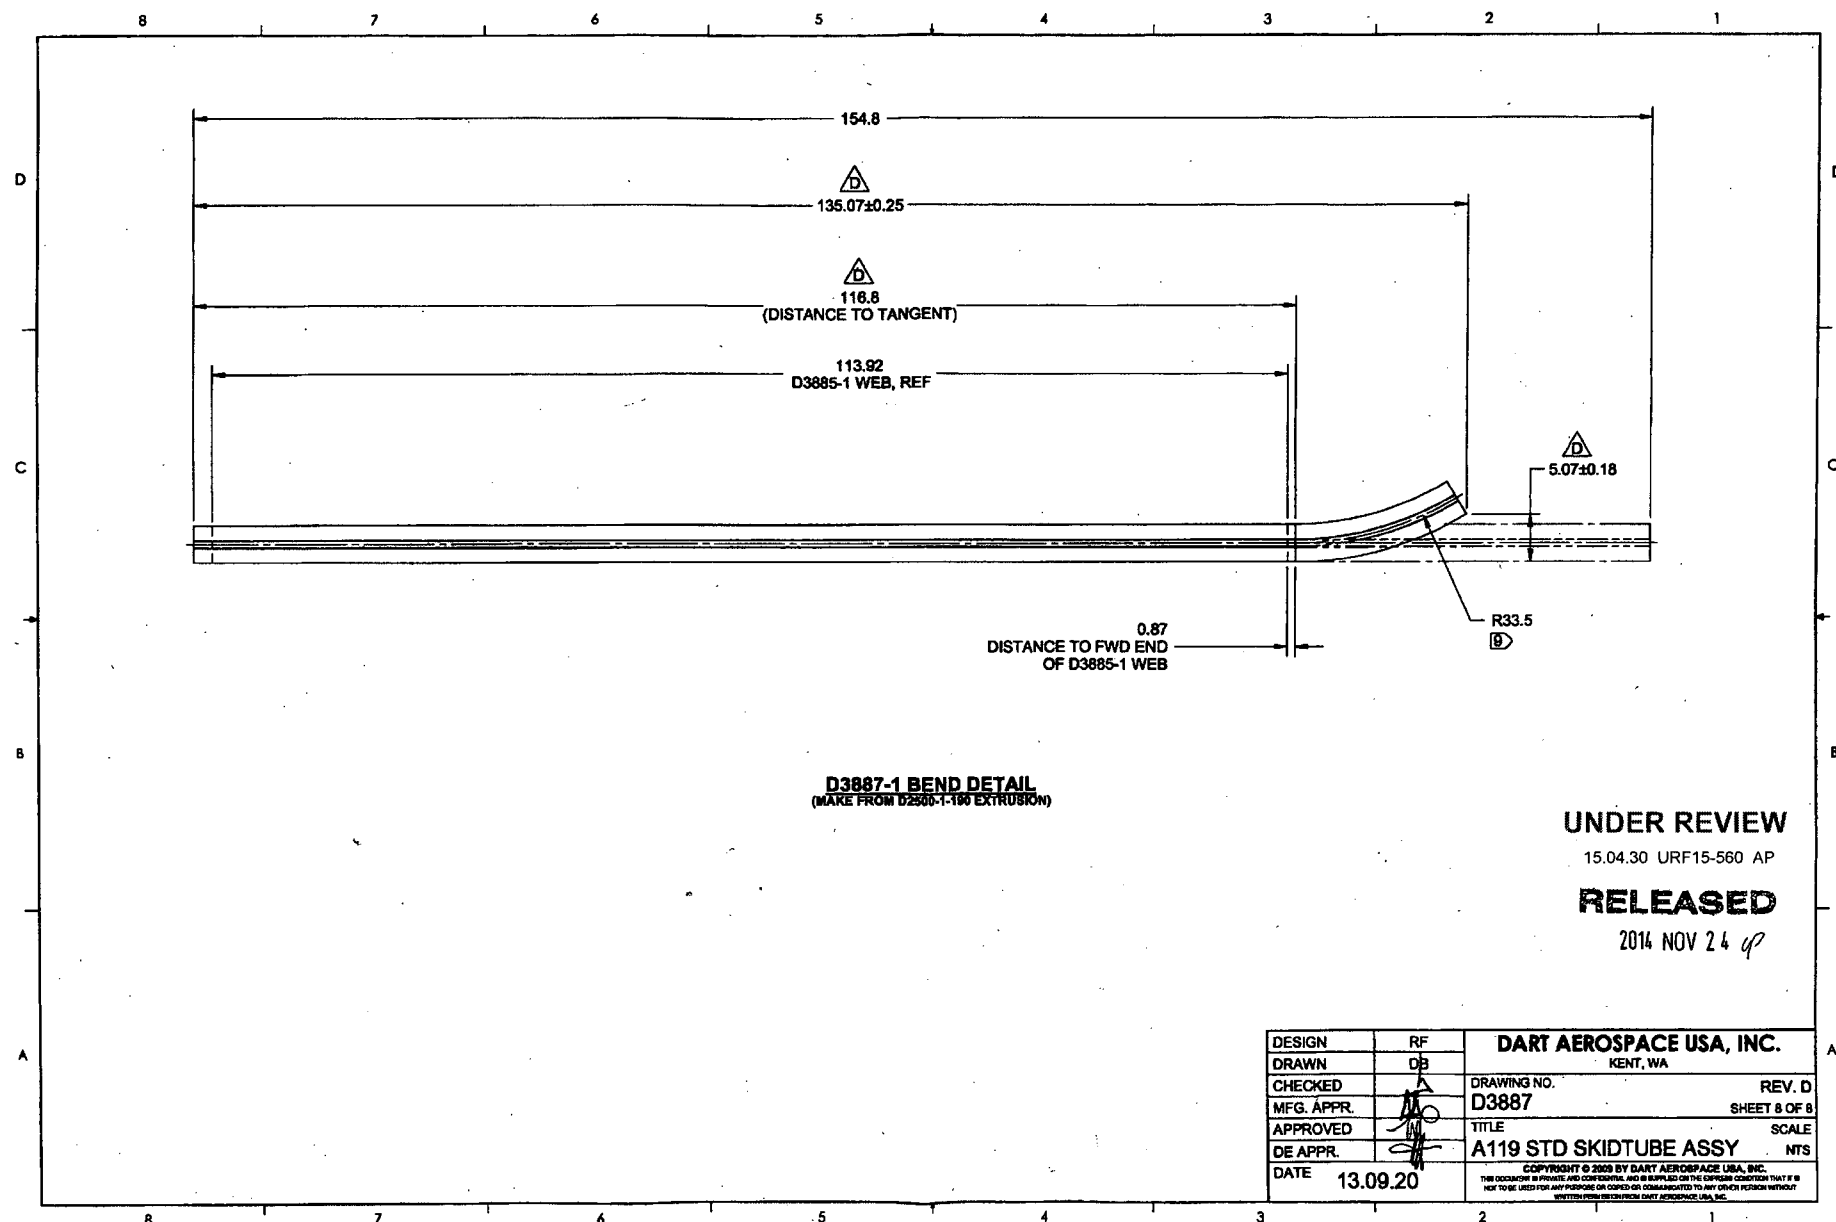

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: <u>1-11705</u> Part No. <u>D119-646-041</u> NCR No. _____		DISPOSITION Rework ☒ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS <table style="width:100%;"> <tr> <td>Skid-tube ☐</td> <td>Cross tube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☒</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>				Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☒	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐																																																	
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☒																																																																				
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																																																																				
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																																																																				
Large Fab ☐	Composite ☐	Supplier ☐																																																																					
Date: <u>16/2/10</u>		Step #: <u>200</u>		QTY Effective: <u>0</u>		MRB (QSI042) Approval <u>16/2/10</u>																																																																	
Description Work Order Deviation <u>No powder cast in saddle location</u>				Disposition <u>Acceptable to powder cast with deviation shown on attached dwg.</u>		Completed By <u>16-05-30</u>																																																																	
						Lead hand / Supervisor Approval Verification DAS 9 9-89 <u>16-04-02</u>																																																																	
						QC / QA Coordinator DAS Approval 9 9-89 <u>16-04-02</u>																																																																	
Root Cause <table style="width:100%;"> <tr> <td>Environment ☐</td> <td>No Re-verification ☐</td> </tr> <tr> <td>Design ☒</td> <td>Operator ☐</td> </tr> <tr> <td>Doc/Data ☐</td> <td>Offset/Setup ☐</td> </tr> <tr> <td>Equip/Tooling ☐</td> <td>Supplier ☐</td> </tr> <tr> <td>Handling/Pre ☐</td> <td>Training ☐</td> </tr> <tr> <td>Material ☐</td> <td>Use for Testing ☐</td> </tr> <tr> <td>Internal Transport ☐</td> <td>Poor Information ☐</td> </tr> <tr> <td>Tribal Knowledge ☐</td> <td>Rushing ☐</td> </tr> <tr> <td>LOA ☐</td> <td>Product Improvement ☐</td> </tr> <tr> <td>Substation ☐</td> <td>Process Improvement ☐</td> </tr> <tr> <td>Past Expiry Date ☐</td> <td>Manufacturing Process ☐</td> </tr> <tr> <td>Misidentified ☐</td> <td>Past Due ☐</td> </tr> </table>		Environment ☐	No Re-verification ☐	Design ☒	Operator ☐	Doc/Data ☐	Offset/Setup ☐	Equip/Tooling ☐	Supplier ☐	Handling/Pre ☐	Training ☐	Material ☐	Use for Testing ☐	Internal Transport ☐	Poor Information ☐	Tribal Knowledge ☐	Rushing ☐	LOA ☐	Product Improvement ☐	Substation ☐	Process Improvement ☐	Past Expiry Date ☐	Manufacturing Process ☐	Misidentified ☐	Past Due ☐	FAULT CATEGORY <table style="width:100%;"> <tr> <td>Pressure/Forced ☐</td> <td>Temperature/Cure ☐</td> <td>Power Loss/Surge ☐</td> <td>Positioned Wrong ☐</td> </tr> <tr> <td>Bending ☐</td> <td>Set-up ☐</td> <td>Folio/Program ☐</td> <td>Outside Dimensions ☐</td> </tr> <tr> <td>Centre Not Concentric ☐</td> <td>BOM/Route ☐</td> <td>Grain ☐</td> <td>Over/Under tolerance ☐</td> </tr> <tr> <td>Cracks ☐</td> <td>Broken/Damage/Defect ☐</td> <td>Weld ☐</td> <td>Part Incorrect ☐</td> </tr> <tr> <td>Crimp/Kink/Ripple/Wave ☐</td> <td>Inspection Incomplete/Unqualified ☐</td> <td>Wrong Stock Pulled ☐</td> <td>Part Lost/Missing ☐</td> </tr> <tr> <td>Cuffs ☐</td> <td>Contamination ☐</td> <td>Out of Sequence ☐</td> <td>Part Moved ☐</td> </tr> <tr> <td>Crushing ☐</td> <td>Countersink ☐</td> <td>Off-set ☐</td> <td>Drawing ☐</td> </tr> <tr> <td>Heat Treat ☐</td> <td>Cut Too Short ☐</td> <td>Mislabeled ☐</td> <td>Finish ☐</td> </tr> <tr> <td>Wave/Twist in Tube ☐</td> <td>Instructions Incomplete/Unclear ☐</td> <td>Fit/Function ☐</td> <td>Misread ☐</td> </tr> <tr> <td>Marks/Chatter ☐</td> <td>Drill Holes ☐</td> <td>Misaligned/off center ☐</td> <td>Turning Sequence ☐</td> </tr> </table>						Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐
Environment ☐	No Re-verification ☐																																																																						
Design ☒	Operator ☐																																																																						
Doc/Data ☐	Offset/Setup ☐																																																																						
Equip/Tooling ☐	Supplier ☐																																																																						
Handling/Pre ☐	Training ☐																																																																						
Material ☐	Use for Testing ☐																																																																						
Internal Transport ☐	Poor Information ☐																																																																						
Tribal Knowledge ☐	Rushing ☐																																																																						
LOA ☐	Product Improvement ☐																																																																						
Substation ☐	Process Improvement ☐																																																																						
Past Expiry Date ☐	Manufacturing Process ☐																																																																						
Misidentified ☐	Past Due ☐																																																																						
Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐																																																																				
Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐																																																																				
Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐																																																																				
Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐																																																																				
Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐																																																																				
Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐																																																																				
Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐																																																																				
Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐																																																																				
Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐																																																																				
Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐																																																																				
		OTHER: <u>customer request</u>																																																																					

DQA:

Date: 16.06.23




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed:

Date: 16/06/02

Work Order update only ☐

Work Order: <u>141705</u> Part No. <u>D119646-041</u> NCR No. <u>16-5812</u>		DISPOSITION Rework ☒ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS <table style="width:100%;"> <tr> <td>Skid-tube ☐</td> <td>Cross tube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☒</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>				Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☒	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐																																																	
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☒																																																																				
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																																																																				
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																																																																				
Large Fab ☐	Composite ☐	Supplier ☐																																																																					
Date: <u>16/2/10</u>		Step #: <u>240</u>		QTY Effective: <u>①</u>		MRB (QSI042) Approval <u>CP</u> <u>16/2/10</u>																																																																	
Description Work Order Deviation <u>Plug unused wearplate holes with AN3C4A RATHER THAN AN3CSA.</u>				Disposition <u>Acceptable. - 5 bolt too long.</u> <u>AN3C-4A M134055 (x6)</u>				Completed By <u>DAS</u> <u>16/02/22</u> <u>15</u> <u>9-89</u>																																																															
				Lead hand / Supervisor Approval Verification DAS <u>9</u> <u>9-89</u> <u>16-04-02</u>																																																																			
				QC / QA Coordinator Approval DAS <u>9</u> <u>9-89</u> <u>16-04-02</u>																																																																			
Root Cause <table style="width:100%;"> <tr><td>Environment ☐</td><td>No Re-verification ☐</td></tr> <tr><td>Design ☐</td><td>Operator ☐</td></tr> <tr><td>Doc/Data ☐</td><td>Offset/Setup ☐</td></tr> <tr><td>Equip/Tooling ☐</td><td>Supplier ☐</td></tr> <tr><td>Handling/Pre ☐</td><td>Training ☐</td></tr> <tr><td>Material ☐</td><td>Use for Testing ☐</td></tr> <tr><td>Internal Transport ☐</td><td>Poor Information ☐</td></tr> <tr><td>Tribal Knowledge ☐</td><td>Rushing ☐</td></tr> <tr><td>LOA ☐</td><td>☒ Product Improvement</td></tr> <tr><td>Substation ☐</td><td>Process Improvement ☐</td></tr> <tr><td>Past Expiry Date ☐</td><td>Manufacturing Process ☐</td></tr> <tr><td>Misidentified ☐</td><td>Past Due ☐</td></tr> </table>		Environment ☐	No Re-verification ☐	Design ☐	Operator ☐	Doc/Data ☐	Offset/Setup ☐	Equip/Tooling ☐	Supplier ☐	Handling/Pre ☐	Training ☐	Material ☐	Use for Testing ☐	Internal Transport ☐	Poor Information ☐	Tribal Knowledge ☐	Rushing ☐	LOA ☐	☒ Product Improvement	Substation ☐	Process Improvement ☐	Past Expiry Date ☐	Manufacturing Process ☐	Misidentified ☐	Past Due ☐	FAULT CATEGORY <table style="width:100%;"> <tr> <td>Pressure/Forced ☐</td> <td>Temperature/Cure ☐</td> <td>Power Loss/Surge ☐</td> <td>Positioned Wrong ☐</td> </tr> <tr> <td>Bending ☐</td> <td>Set-up ☐</td> <td>Folio/Program ☐</td> <td>Outside Dimensions ☐</td> </tr> <tr> <td>Centre Not Concentric ☐</td> <td>BOM/Route ☐</td> <td>Grain ☐</td> <td>Over/Under tolerance ☐</td> </tr> <tr> <td>Cracks ☐</td> <td>Broken/Damage/Defect ☐</td> <td>Weld ☐</td> <td>Part Incorrect ☐</td> </tr> <tr> <td>Crimp/Kink/Ripple/Wave ☐</td> <td>Inspection Incomplete/Unqualified ☐</td> <td>Wrong Stock Pulled ☐</td> <td>Part Lost/Missing ☐</td> </tr> <tr> <td>Cuffs ☐</td> <td>Contamination ☐</td> <td>Out of Sequence ☐</td> <td>Part Moved ☐</td> </tr> <tr> <td>Crushing ☐</td> <td>Countersink ☐</td> <td>Off-set ☐</td> <td>Drawing ☐</td> </tr> <tr> <td>Heat Treat ☐</td> <td>Cut Too Short ☐</td> <td>Mislabeled ☐</td> <td>Finish ☐</td> </tr> <tr> <td>Wave/Twist in Tube ☐</td> <td>Instructions Incomplete/Unclear ☐</td> <td>☒ Fit/Function</td> <td>Misread ☐</td> </tr> <tr> <td>Marks/Chatter ☐</td> <td>Drill Holes ☐</td> <td>Misaligned/off center ☐</td> <td>Turning Sequence ☐</td> </tr> </table>						Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	☒ Fit/Function	Misread ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐
Environment ☐	No Re-verification ☐																																																																						
Design ☐	Operator ☐																																																																						
Doc/Data ☐	Offset/Setup ☐																																																																						
Equip/Tooling ☐	Supplier ☐																																																																						
Handling/Pre ☐	Training ☐																																																																						
Material ☐	Use for Testing ☐																																																																						
Internal Transport ☐	Poor Information ☐																																																																						
Tribal Knowledge ☐	Rushing ☐																																																																						
LOA ☐	☒ Product Improvement																																																																						
Substation ☐	Process Improvement ☐																																																																						
Past Expiry Date ☐	Manufacturing Process ☐																																																																						
Misidentified ☐	Past Due ☐																																																																						
Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐																																																																				
Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐																																																																				
Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐																																																																				
Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐																																																																				
Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐																																																																				
Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐																																																																				
Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐																																																																				
Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐																																																																				
Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	☒ Fit/Function	Misread ☐																																																																				
Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐																																																																				
		OTHER: ☐																																																																					

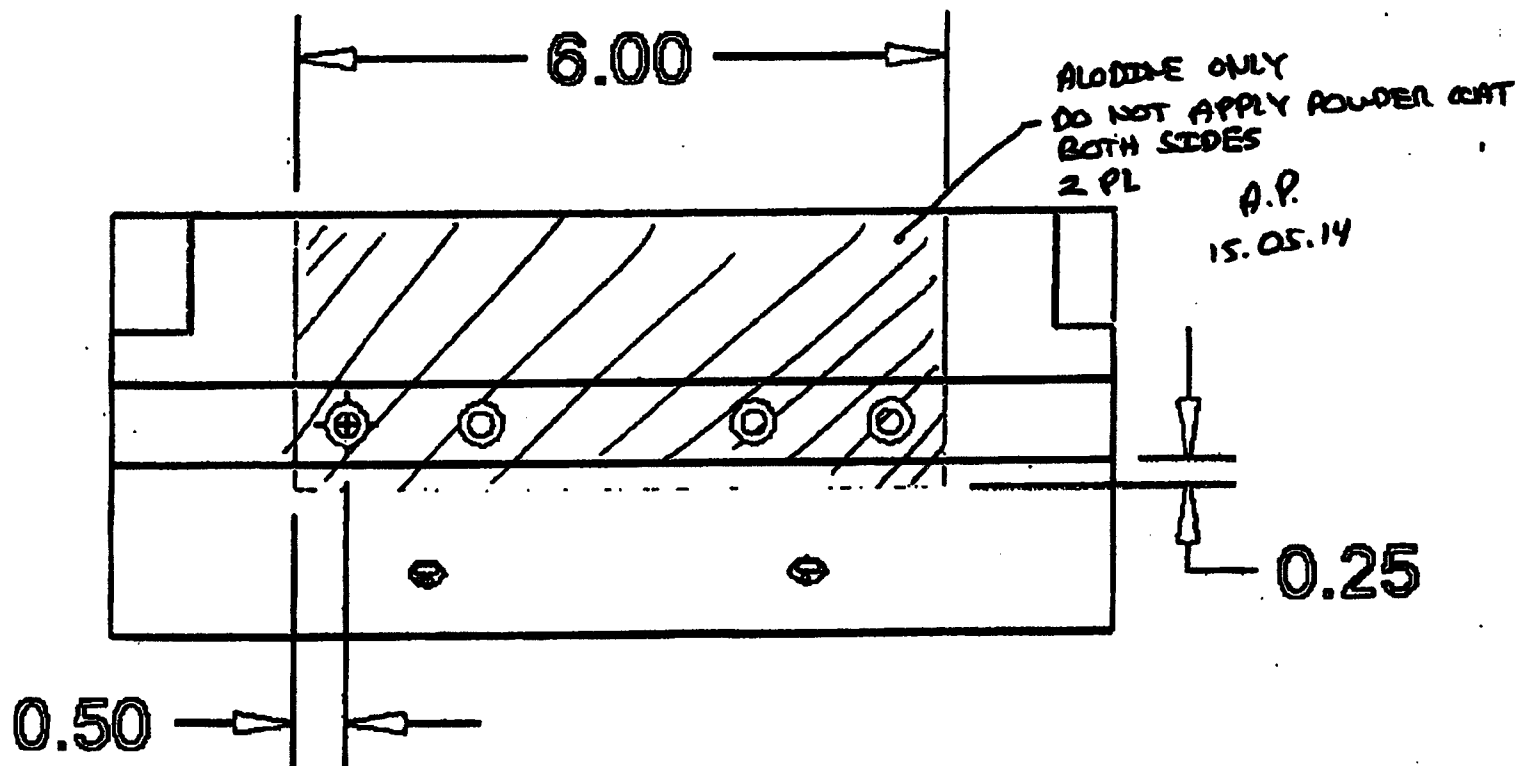

11/17/63

